

LAND CORNER RECORD

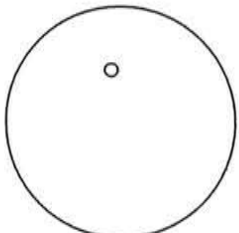
Index: Q-11	Corner: Center South Sixteenth corner			State of Indiana - Hoosier National Forest
Section: 21	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1375639.16	Lon./E: 3142627.44	Datum: NAD83(2011) US survey feet	

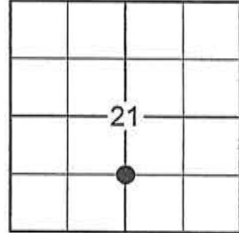
CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph: 
Undated	USFS Surveyor	3" galvanized pipe with brass cap	On file in USFS office.		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Short Leaf Pine	5"	S28°W	13.52'	
	Red Oak	6"	N61°E	3.22'	
Record evidence of prior survey:	Found 3" galvanized pipe.				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
9/12/2014	Eric L. Deckard L.S. #29900012	3" pipe with brass cap	Instr. #2014014303		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
Record evidence of prior survey:	Found 3" pipe with brass cap				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Center of Black Oak	16"	N55°E	3.3'
	Mag nail in Pignut Hickory	15"	N81°E	25.77'
	Mag nail in Chestnut	11"	S29°E	23.74'
	Mag nail in Sugar Maple	7"	S33°W	10.91'
Monument Found or Set:	Found a 3" galvanized pipe with brass cap, 0.4' above grade.			

MONUMENT SKETCH	NARRATIVE REFERENCE:
	Monument is a 3" galvanized pipe with brass cap, 0.4' above grade, a carsonite post is located immediately to the west of monument. Located at South edge of Pine grove on Western side of flat area, approximately 70' West of East facing slope, approximately 50' East of West facing slope, approximately 100' North of South facing slope.

SECTION DIAGRAM	PERPETUATION RECORD:
 Corner Location = ●	This monument was set by the USFS as shown on the c.1980 USFS survey of the Southeast Quarter of Section 21 (on file in the USFS office), and is also shown on the hand drawn sketch of Section 21 by Ken Anderson, dated 11-23-1982 (on file in the USFS office). This pipe is less than 1 foot from the midpoint of a line from the Mag spike found at R-11 (Quarter Corner common to Sections 21 and Section 28) and the stone found at P-11 (Center Quarter corner of Section 21). This pipe was also accepted on the survey by Eric L. Deckard, dated 9/12/2014 (Inst. #2014014303). The record monument was found undisturbed and maintained by remarking the existing bearing trees or establishing new bearing trees. One existing bearing tree was recovered from an undated Land Corner Record and remarked. Three new bearing trees were established. Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.
Section: 21 T7N R1E	Prepared By: BRG (Project#3-565) Date: 6/2015

Referenced on BRCJ survey recorded as InstNo.2016001724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

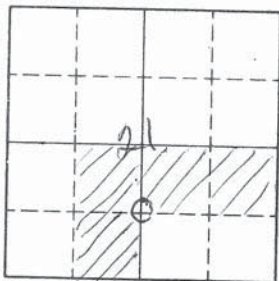
Index No. 211
(Alphabetical-Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 802-127

T. 7N R. R1E 2nd Mer. N.F. Hoosier County Monroe State Ind.
CS 1/16 Corner common to sections 21 and _____

EXISTING SURVEYS	
Original Government Survey Year surveyed _____ Original monument _____ (Wood post, stone, pile of stones, pipe, etc.) Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Evidence Found Year of search _____ By _____ Monument found _____ Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc.) Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	Evidence of Subsequent Corner Restoration Found Year of search _____ By _____ _____ _____ _____ Bearing Trees, Reference Objects _____ _____ _____ _____



Sketch

○ Corner ■ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. Monument 3" galv. pipe with brass cap. Located on ridge top in Shortleaf pine plantation on south side of ridge. Fence from East and South corner app 45' Southwest of monument.

Perpetuation Record

Monument and accessories established. Include brief description of area.

<u>B. T.</u>	<u>B. T.</u>
<u>Shortleaf Pine</u>	<u>Red Oak</u>
<u>5"</u>	<u>6"</u>
<u>S 28° W</u>	<u>N 61° E</u>
<u>13.52'</u>	<u>3.22'</u>

Certified corner restoration certificate prepared: Yes _____ No _____
 Filed in county records at _____ Date _____ County Document No. _____
 Identified on aerial photo No. _____ Which is filed at _____

At time of search:

1. Did you have the record description?
 Yes _____ No _____

2. How was search area located?
 Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No ☒

5. Signature Jim Cunningham